

Kundendienstinformation · After-Sales Service Information · Kundendienstinformation

96/2 M 20/M 32

Hand pump HV 6013 for hydraulic tool set

Due to latest operating experiences the hand pump design was changed in order to attain an improved operating reliability.

In future the loose ball in the suction valve will be spring-loaded whereas the spring of the pressure valve be replaced by a weaker one.

To attain the improved operating reliability also on the hand pumps which have already been delivered, the spring in the pressure valve and the complete suction valve must be replaced by the new design.

For this purpose a modification set with all necessary parts, a manual for modification and general operating instructions for the hand pump will be given on board by the respective service station. The modification can be easily done by the crew.

Telefax: (-431) 39 95-8 27 Telex: 2 92 993 mak d Teletex: 17 431 105 MaK