



Service Information No. 10 / 07

Date: July 09, 2007

Bracket on emergency air pipe for stop cylinder

VM32C

This Service Information is intended to provide you some important information about the double clamping on the emergency air pipe for stop cylinders used at all current VM32C engine series.

It is necessary to check the position of the double clamping's at the emergency air pipe for the stop cylinder.

As shown on the following photo the clamping has to be moved close to the main bracket.

In some few cases the air supply pipe for the emergency stop cylinders broke close respectively directly on the main bracket as indicated on the photo.

Due to the position of the pressure gauge pipe bracket, as shown on the photo, vibrations were transmitted to the air supply pipe for the emergency stop cylinders, which caused the pipe failure. Therefore the position of the bracket has to be checked and if necessary corrected.

